


Table 2: Bright Washers - Large diameter series
(Forms C and D)

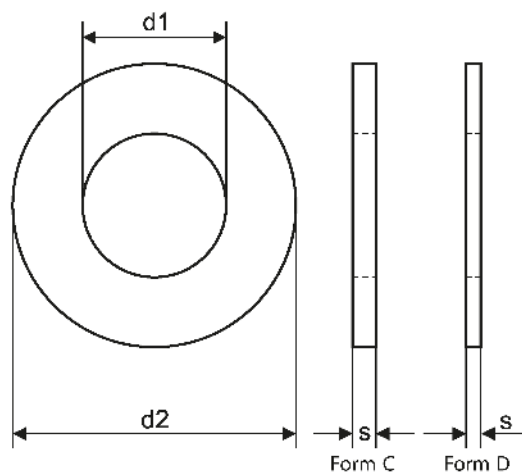

BS 4320 Dimensions of washers (Forms C and D)

Nominal size of bolt or screw	Inside diameter d1			Outside diameter d2			Thickness s					
							Form C (Normal range)			Form D (Normal range)		
	nom.	max.	min.	nom.	max.	min.	nom.	max.	min.	nom.	max.	min.
M4	4.3	4.5	4.3	10.0	10.0	9.7	0.8	0.9	0.7	-	-	-
M5	5.3	5.5	5.3	12.5	12.5	12.1	1.0	1.1	0.9	-	-	-
M6	6.4	6.7	6.4	14.0	14.0	13.6	1.6	1.8	1.4	0.8	0.9	0.7
M8	8.4	8.7	8.4	21.0	21.0	20.5	1.6	1.8	1.4	1.0	1.1	0.9
M10	10.5	10.9	10.5	24.0	24.0	23.5	2.0	2.2	1.8	1.25	1.45	1.05
M12	13.0	13.4	13.0	28.0	28.0	27.5	2.5	2.7	2.3	1.6	1.8	1.4
(M14)	15.0	15.4	15.0	30.0	30.0	29.5	2.5	2.7	2.3	1.6	1.8	1.4
M16	17.0	17.4	17.0	34.0	34.0	33.2	3.0	3.3	2.7	2.0	2.2	1.8
(M18)	19.0	19.5	19.0	37.0	37.0	36.2	3.0	3.3	2.7	2.0	2.2	1.8
M20	21.0	21.5	21.0	39.0	39.0	38.2	3.0	3.3	2.7	2.0	2.2	1.8
(M22)	23.0	23.5	23.0	44.0	44.0	43.2	3.0	3.3	2.7	2.0	2.2	1.8
M24	25.0	25.5	25.0	50.0	50.0	49.2	4.0	4.3	3.7	2.5	2.7	2.3
(M27)	28.0	28.5	28.0	56.0	56.0	55.0	4.0	4.3	3.7	2.5	2.7	2.3
M30	31.0	31.6	31.0	60.0	60.0	59.0	4.0	4.3	3.7	2.5	2.7	2.3
(M33)	31.0	31.6	31.0	66.0	66.0	65.0	5.0	5.6	4.4	3.0	3.3	2.7
M36	37.0	37.6	37.0	72.0	72.0	71.0	5.0	5.6	4.4	3.0	3.3	2.7
(M39)	40.0	40.6	40.0	77.0	77.0	76.0	6.0	6.6	5.4	3.0	3.3	2.7